



PO Box 391578 Anza, CA 92539 Lic. 8913456 C-55, C57
 (951) 763-2210 Office (909) 602-6320 Fax
 heritagewellservice@yahoo.com www.heritagewellservice.com

WELL REPORT NO. 675

Customer: Mike Pique
Telephone: (858) 354-4391
Mail Address:
Well Location: 32762 S. Grade Rd. Palomar Mountain, CA
APN: 135-030-12-00
Drilled By: not known **Date Drilled:** not known

Well Data

	Data	MDT	CR	OR	NM
Depth of Well	440 ft.	X			
Diameter Casing	8 in, open hole	X			
Depth of Perforation	n/a	X			
Pump HP & Type	WT0715	X			
Depth Pump Set	420 ft.	X			

Source Codes: MDT = measured during test, CR = Company Records, OR = Owner Records, NM= Not Measured

Well Test

Date of Test: 5/1/2015

Measured Production: Observed Total Production: 1,440.0 gallons
 Average Yield for Pumping Duration: 12 gpm

** Due to the unknown nature of ground water and used pumping equipment, this inspection/certification does in no way warranty the condition of the well or its equipment beyond the date of inspection. This certification reflects the well/well system on the date of the inspection only**

Constant Pumping Level Test: Final Observed Yield Rate: 12 gpm
 Pumping Duration: 2 hours
 Pump Borke Suction During Test: **NO**

Water System Visual Inspection

	Data	Functional	Deficient	Not Observed
Well Pump Operation	1.5 HP	X		
Electrical Equipment		X		
Pressure Tank(s)	none			X
Water Pipes	1.25" galvanized	X		
Storage Tank(s)				X
Booster Pump Operation				X

Comments:


New well pump installed, carries manufacturer warranty until 05/01/2020, system needs to be put on a pressure system for regular use. There is a storage tank on site, but it has been tipped over and is not useable at this time.

Specializing in:

Well Driling - Submersbile Booster Pumps - Storage Tanks - Well Certifications - Filtration - Well Cleaning

WELL PRODUCTION LOG

Minutes	AMPS	GPM
0	11.3	12
10	11.2	12
20	11.2	12
30	11.1	12
40	11.1	12
50	11.1	12
60	11.1	12
70	11.1	12
80	11.1	12
90	11.1	12
100	11.1	12
110	11.1	12
120	11.1	12

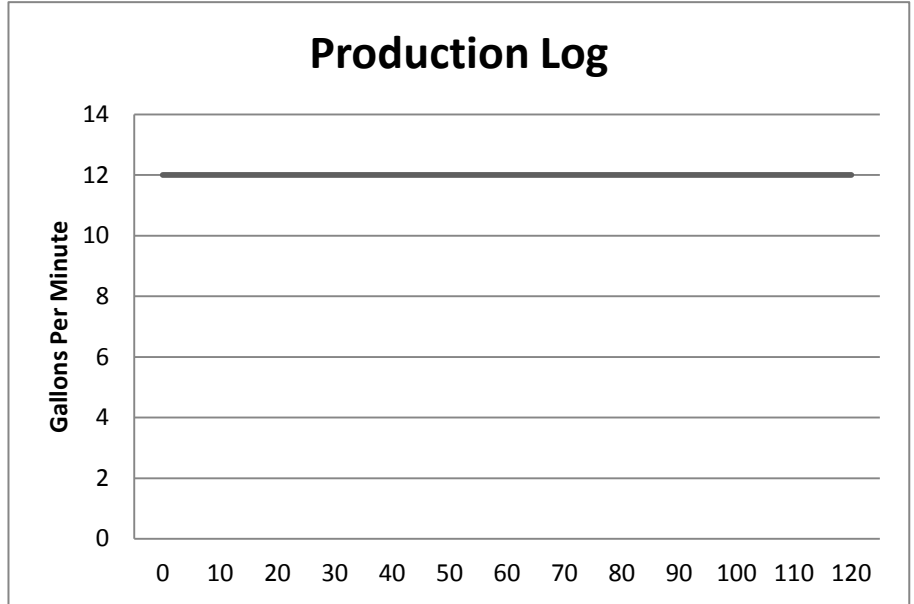

Job Site Photos:

Well Head



Electrical

Pressure Tank(s)

Water Pipes

Storage Tank(s)

Not Observed

Booster Pump

Not Observed

Escrow Information:

Not Known

Realtor Information:

Bonnie Phelps, Remax Realty

Water Testing Information (If Applicable):

Babcock & Sons, Inc. 951-653-3351

Dated: 4/30/2015

By: Eric J. Haley
Owner/Operator

Specializing in:

Well Drilling - Submersible Booster Pumps - Storage Tanks - Well Certifications - Filtration - Well Cleaning